

THIRD-ORDER LEVELING
SEA LEVEL DATUM OF 1929

HAMLET QUADRANGLE
47 N.C.-131 S.C.
N3445-W7930/15
DIAGRAM NI 17-6
FLORENCE

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Richmond and Scotland Counties, N.C.;
Narboro County, S. C.

Final adjustment of 1972


Edition of 2/25/72

PR: WSM/jyk

JACKSON SPRINGS
(75)

ROCKINGHAM
(48 N.C.-132 S.C.)

LAURINBURG
(46)

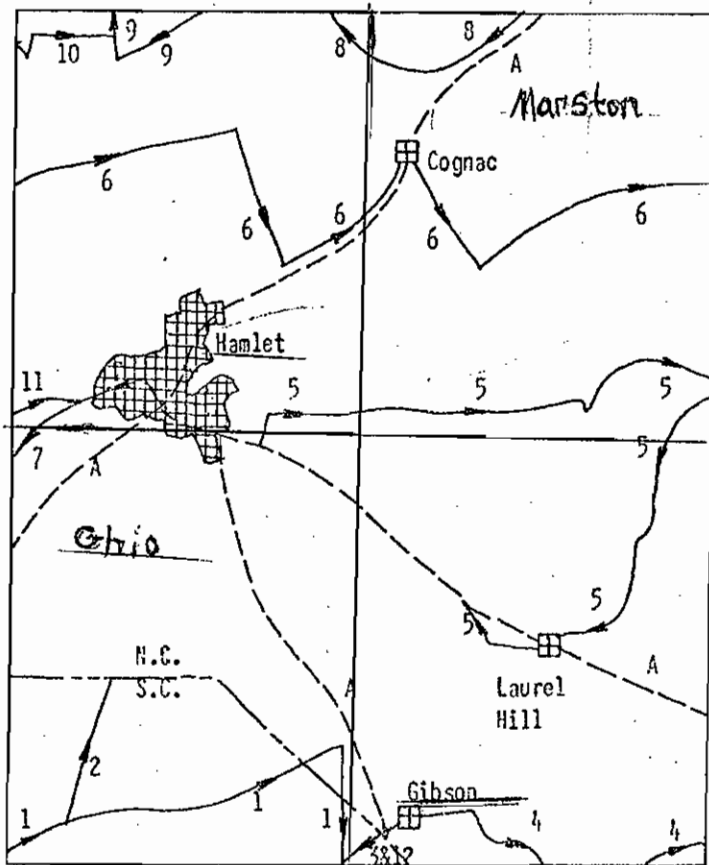

BENNETTSVILLE
(132 N.C.-115 S.C.)

NGS (USCGS) VERTICAL CONTROL DATA

A. Quadrangle 340734

NGVD 29
Elevations

INDEX OF PERMANENT MARKS

MARK USGS)	PAGE NO.	NGS & STATE SURVEY	PAGE NO.
TT 40 H 1934 NOT FOUND <u>4/25/89</u>	3	MB 152	3
TT 49 H 1934	3	MB 158	3
TT 50 H 1934 NOT FOUND <u>4/25/89</u>	3		
1 RLB 1949 245 NOT FOUND <u>1/23/89</u>	3		
2 RLB 1949 232	4	USED	
3 RLB 1949 217 NOT FOUND <u>1/23/89</u>	4		
8 RLB 1949 276 NOT FOUND <u>1/23/89</u>	5	C of E MON 30 30TH ENGRS DESTROYED <u>1/11/89</u>	
9 RLB 1949 210 DESTROYED <u>2/12/89</u>	5	D 30 A 1/3 TT 1 G 2 NOT FOUND <u>2/17/89</u>	
10 RLB 1949 254 NOT FOUND <u>2/17/89</u>	5		
11 RLB 1949 334	4		
12 RLB 1949 369 NOT FOUND <u>1/23/89</u>	4	NGS	
13 RLB 1949 334	5	ENTWISTLE 1933	6
14 RLB 1949 RESET 1968	5	ENTWISTLE NO 1 1933	6
15 RLB 1949 316 NOT FOUND	5	ENTWISTLE NO 2 1933	6
19 RLB 1949 298	6	FRUITLAND NO 1 1933 DESTROYED <u>4/17/89</u>	6
20 RLB 1949 355 NOT FOUND <u>2/17/89</u>	6	GIBSON 1933	3,10
21 RLB 1949 390 NOT FOUND <u>2/17/89</u>	6	GIBSON NO 2 1933-1937 NOT FOUND <u>4/17/89</u>	10
22 RLB 1949 405 NOT FOUND <u>4/17/89</u>	7	Q 52 1933 DESTROYED <u>1/23/89</u>	8
23 RLB 1949 399 NOT FOUND <u>4/17/89</u>	7	W 52 1933	10
24 RLB 1949 351	7	Y 52 1933	3
25 RLB 1949 322 NOT FOUND <u>4/17/89</u>	7	B 79 1934	4
26 RLB 1949 396 DISTURBED <u>4/17/89</u>	8,9		
29 RLB 1949 374	8,9		
20 WSM 1949 440 NOT FOUND <u>4/17/89</u>	8		
21 WSM 1949 409 NOT FOUND <u>4/17/89</u>	8		
22 WSM 1949 381 DESTROYED <u>4/17/89</u>	9		
TT 2 HF 1949 354 DISTURBED <u>4/17/89</u>	9		
TT 3 HF 1949 255 DESTROYED <u>4/17/89</u>	9		

3

HAMLET
Book B 6274

N.C.-S.C.

C. E. Watkins

1934

LINE 1.

Feet:

C. E. Watkins, 1934; Book B 6274

Aarons Temple, 145 ft. NW. of NW. corner of; NGS and State Survey standard disk stamped "MB 158"
(Reported destroyed, 1949)

256.715

Aarons Temple, 1.8 mi. E. of; 45 ft. SW. of intersection of E.-W. rd. and State Highway 96;
NGS and State Survey standard disk stamped "MB 152" **USGS REPORT NOT FOUND**

4/25/89

257.792

Aarons Temple, 3.0 mi. E. of; 50 ft. S. of center of rd.; 48 ft. N. and 3 ft. E. of NW. corner of
Baptist Church; in frontyard; in 7- by 7-in. concrete post; standard tablet stamped
"TT 49 H 1934"

254.430

Reference mark; 25 ft. N. of tablet; 60 ft. N. of NW. corner of church; 35 ft. S. of center of rd.;
in root on N. side of 8-in. oak tree; wire nail

253.93

Gibson, 2.5 mi. NW. of; 5.5 mi. E. of Aarons Temple; 48 ft. N. of center of rd.; at North Carolina-
South Carolina State line; in 7- by 7-in. concrete post; standard tablet stamped
"TT 50 H 1934" (Reported not found, 1949)

263.388

LINE 2.

C. E. Watkins, 1934; Book B 6274

Aarons Temple, 3.5 mi. N. of; 6.0 mi. S. of Hamlet; at North Carolina-South Carolina State line;
18 ft. W. of center of hwy.; in 7- by 7-in. concrete post; standard tablet stamped "TT 40 H 1934"
(Reported not found, 1964)

321.424

LINE 3.

Leveled twice by C. E. Watkins, 1934; Book B 6274

Gibson, 0.5 mi. SW. of; on North Carolina-South Carolina State line; on property of J. C. Hunsucker;
in cultivated area at S. edge of orchard; 38 ft. W. of State Highway 203; at end of pavement;
22 ft. from monument lettered 1905; in concrete post; NGS standard triangulation station disk
stamped "GIBSON 1933"

249.799

LINE 4.

R. L. Beitle, 1949; Book AV 82

NGVD 29
Elevations

"Y 52 1933" (NGS)

254.960

Gibson, 1.0 mi. E. of, along State Highway 79; 34 ft. N. of center of hwy.; 94 ft. SW. of brick chimney
on house; in root on SW. side of 36-in. red oak tree; copper nail and washer

245.07

Gibson, 1.7 mi. E. of, along State Highway 79, thence 0.4 mi. SE. along sand rd.; 25 ft. N. and 19 ft.
W. of junction of I-rd. S.; at edge of plowed field; in concrete post projecting 0.3 ft.;
standard tablet stamped "1 RLB 1949 245" **USGS REPORT NOT FOUND**

1/23/89

244.675

NOT FOUND

1949

LINE 4 (Cont'd.)Feet

Reference mark; 0.18 mi N. of tablet; 14 ft W. of center of rd.; 36 ft SE. of SE. corner of porch of house; in root on NE. side of 40-in. red oak tree; copper nail and washer 245.55

U.E., Gibson, 1.7 mi E. of, along hwy., thence 1.5 mi SE. along sand rd.; 0.4 mi SW., thence 2.3 mi NW. of locks on Lytchs Pond; 127 ft S. of center of rd.; 46 ft SE. of SE. corner of porch; in root on NW. side of twin trunk 30-in. oak tree; copper nail and washer 234.00

Locks on Lytchs Pond, 0.4 mi SW. of, along paved rd., thence 1.5 mi NW. along sand rd.; at E. fork of offset crossroads; 21 ft W. of center of rd.; in concrete post projecting 0.3 ft.; standard tablet stamped "2 RLB 1949 232" (Reported destroyed, 1949) 231.523

Reference mark; 245 ft S. of tablet; 19 ft E. of rd., at fork W. and on prolongation of centerline on concrete post projecting 0.5 ft.; chiseled square 230.84

[Jogs into Bennettsville quadrangle]

Laurinburg, 4.1 mi SW. of; 0.4 mi NE. of Lytchs Pond; at junction of Y-rd. N.; 31 ft NW. of center of paved rd.; 43 ft E. of center of graveled rd.; 1 ft SE. of fence corner; in concrete post projecting 0.2 ft.; standard tablet stamped "3 RLB 1949 217" *USGS REPORT 1/23/89* 216.510
NOT FOUND

Reference mark; 210 ft W. of tablet; 85 ft NW. of center of paved rd.; in root on W. side of lone 30-in. white oak tree; copper nail and washer 212.21

LINE 5.

R. L. Beitle, 1949; Book AV 82

"B 79 1934" (NGS) 355.839

Hamlet, 1.8 mi SE. of, along U. S. Highway 74, thence 2.3 mi NE. along macadam and sand rds.; 2.3 mi W. of Richmond-Scotland County line; 39 ft NE. of center of rd.; 34 ft SE. of center of driveway NE.; in concrete post projecting 0.2 ft.; standard tablet stamped "11 RLB 1949 334" 333.579

Reference mark; 7 ft W. of tablet; 33 ft NE. of center of rd.; in base on S. side of 10-in. pine tree; rail spike 333.24

Hamlet, 1.8 mi SE. of, thence 4.4 mi NE. along sand rds.; 1.3 mi SW. of, thence 7.0 mi W. along sand rds. from Silver Hill; 0.2 mi W. of Richmond-Scotland County line; 36 ft N. and 44 ft W. of intersection; in concrete post projecting 0.2 ft.; standard tablet stamped "12 RLB 1949 369" 368.633
USGS REPORT NE 1/23/89 NOT FOUND

Reference mark; 30 ft NE. of tablet; 40 ft NW. of center of forks of rd. N.; in base on S. side of 10-in. oak tree; copper nail and washer 367.06

LINE 5 (Cont'd.)Feet

Silver Hill, 1.3 mi SW. of, thence 5.0 mi W. along sand rds.; 1.9 mi E. of Richmond-Scotland County line; 31 ft N. and 28 ft E. of crossroads; in concrete post projecting 0.2 ft.; standard tablet stamped "13 RLB 1949 334" 334.408

Reference mark; 53 ft S. of tablet; 28 ft E. of center of forks of rd. S.; in base on N. side of 14-in. pine tree; rail spike 335.38

Silver Hill, 1.2 mi SW. of, along secondary State Road 1335, thence 2.0 mi NW. along secondary State Road 1345, thence 1.8 mi SW. along secondary State Road 1341; 3.3 mi E. of Richmond-Scotland County line; 7 ft S. and 45 ft W. of junction of secondary State Roads 1341 and 1001; in concrete post; standard tablet stamped "14 RLB 1949 RESET 1968" 234.059

Reference mark; 14 ft N. of tablet; 29 ft NW. of rd. forks; in base on NW. side of 14-in. red oak tree; copper nail and washer 234.26

Silver Hill, 1.3 mi SW. of, thence 1.1 mi NW. along sand rds.; 20 ft NE. of center of rd.; 37 ft SW. of SW. corner of red shingled house; in concrete post projecting 0.5 ft.; standard tablet stamped "15 RLB 1949 316" *USGS REPORT* NOT FOUND 1/23/89 315.952

Reference mark; 21 ft NE. of tablet; 39 ft NE. of center of rd.; in base on SW. side of 12-in. red oak tree; copper nail and washer 314.94

Silver Hill, 2.0 mi SW. of, along sand rd.; 4.2 mi N. of Richmond Mills; 19 ft SW. and 22 ft SE. of din crossroads; 14 ft SW. of fork SE.; in concrete post projecting 0.3 ft.; standard tablet stamped "8 RLB 1948 276" *USGS REPORT* 1/23/89 NOT FOUND 1/23 276.457

Reference mark; 101 ft NE. of tablet; 32 ft SE. of center of rd.; in base on NW. side of 12-in. pine tree; rail spike 281.06

Richmond Mills, 2.0 mi N. of, along sand rd.; 3.8 mi SW. of Silver Hill; 24 ft N. and 30 ft W. of crossroads; in concrete post; on iron pipe; USED standard cap stamped "C of E MOX 30 30TH ENGRS" *USGS REPORT DESTROYED "MARK FOUND LAYING ON SIDE."* DESTROYED 1/11/89 242.538

Richmond Mills; 56 ft S. of center of hwy.; 6.4 ft N. of, and in line with side of Lakeside Presbyterian Church; in concrete post projecting 0.2 ft.; standard tablet stamped "9 RLB 1949 210" *MARK HAD BEEN MOVED & WAS STANDING + 100' FROM RM ON BRIDGE. DISK RECLAIMED.* DESTROYED 1/11/89 209.856 (Found 11-05-04)

Reference mark; 200 ft NE. of tablet; on SW. wheelguard of bridge over stream; chiseled L 212.05

Laurel Hill; 59 ft SE. of SE. corner of Seaboard Air Line Railroad station; 44 ft NE. of NE. rail of main track; 30 ft SE. of center of rd.; in concrete post projecting 0.2 ft.; standard tablet stamped "10 RLB 1949 254" *USGS REPORT* 2/17/89 NOT FOUND 253.881

Reference mark; 105 ft W. of tablet; 51 ft N. of T-rd. junction; on NE. end of culvert headwall; chiseled L 252.76

"E 79 1934" (HGS) 253.362

6
HAMLET
Book AV 82

N.C.-S. C.

R. L. Beitle

1949

LINE 6.

Feet

R. L. Beitle, 1949; Book AV 82

Rockingham, 1.5 mi NE. of, along U. S. Highway 1; 62 ft W. of intersection of rd. to Roberdell; 37 ft N. of center of hwy.; 48 ft SW. of SW. corner of "Otto's Place"; 2.5 ft NE. of power pole; in concrete post projecting 0.3 ft.; standard tablet stamped "19 RLB 1949 298"
(Destroyed, 1965)

298.196

Reference mark; 39 ft SW. of tablet; 19 ft N. of center of rd.; on W. end of L-shaped headwall of concrete culvert; chiseled L

296.47

Rockingham, 4.1 mi NE. of, along U. S. Highway 1; at Airport Inn; 84 ft S. of crossroads; 34 ft E. of center of rd. S.; 53 ft W. of S. corner of inn; in concrete post projecting 0.2 ft.; standard tablet stamped "20 RLB 1949 355"

USGS REPORT 2/17/89

NOT FOUND

355.203

Reference mark; 94 ft NE. of tablet; 33 ft S. of center of hwy.; on E. end of base of gasoline pump; chiseled L

356.22

Hamlet, 5.0 mi N. of; 48 ft E. of center of dirt rd. extended; 36 ft S. of center of U. S. Highway 1; in concrete post; NGS standard triangulation station disk stamped "ENTWISTLE 1933"

369.583

Reference mark; 1.8 ft S. of Entwistle triangulation station; on iron pipe; USED standard cap stamped "D 30A 1/3 TT 1 G 2"

USGS REPORT

NOT FOUND

2/17/89 370.201

Reference mark No. 1; 98 ft ENE. of station; 28 ft S. of center of hwy.; 300 ft S. of, and in line with ridge of Mr. Loves barn; in concrete post; NGS standard reference mark disk stamped "ENTWISTLE NO 1 1933"

369.688

Reference mark No. 2; 0.4 mi ENE. of station; on property of Mrs. E. B. Morse; 75 ft W. of and in line with service station; across hwy. from W. gatepost of entrance to Rockingham Country Club; 1 ft SE. of corner pole of N.-S. and E.-W. powerlines; in concrete post; NGS standard reference mark disk stamped "ENTWISTLE NO 2 1933"

359.824

Rockingham, 6.1 mi NE. of, along U. S. Highway 1, thence 1.0 mi SE. along sand rd.; 3.4 mi NE. of, along State Highway 77, thence 1.9 mi NW. along sand rd. from Hamlet; 39 ft SW. of junction of woods rd. W.; 29 ft W. of center of main rd.; 23 ft S. of center of woods rd.; in concrete post projecting 0.3 ft.; standard tablet stamped "21 RLB 1949 390"

NOT FOUND

7/1/89 389.677

Reference mark; 15 ft W. of tablet; 43 ft W. of center of sand rd.; 26 ft S. of center of woods rd. W.; in base on E. side of 14-in. pine tree; rail spike

389.83

U.E., Hamlet, 3.4 mi NE. of, along hwy., thence 0.8 mi NW. along sand rd.; 14 ft E. of center of rd.; at S. end of orchard and in line with row of trees E.; in concrete in top of iron pipe; copper nail and washer

419.03

Hamlet, 3.5 mi NE. of, along State Highway 77; 20 ft SE. of center of hwy.; 71 ft NNE. of station; in concrete post projecting 0.7 ft.; NGS standard reference mark disk stamped

"FRUITLAND NO 1 1933"

USGS REPORT MARK RECOVERED SITTING UPRIGHT COMPLETELY OUT OF GROUND. GDW

DESTROYED

454.109

HAMLET
Book AV 82

N.C.-S.C. NGVD 29
Elevations

R. L. Beitle

1949

LINE 6 (Cont'd.)Feet

Cognac, 1.8 mi SW. of, along S.A.L. RR.; on curve and on prolongation of W. rail of south-bound track; 33 ft SE. of SE. rail of north-bound track; 33 ft SE. of SE. rail of north-bound track; 12 ft NW. of NW. rail of spur track; 61 ft W. of SW. corner of block signal foundation 2478B; 11 ft SW. of SW. corner of signalman's shack; in concrete post projecting 0.2 ft.; standard tablet stamped "22 RLB 1949 405" *USGS REPORT* NOT FOUND 4/17/89 405.286

Reference mark; 58 ft NE. of tablet; at spur track; on NW. corner of concrete base of signal 2478A; chiseled L 408.05

U.E., Cognac, 0.7 mi SW. of, along S.A.L. RR.; on first curve S. of settlement; 93 ft E. of E. rail; 62 ft W. of center of private rd.; at old peach sorting building; in base on W. side of 10-in. pine tree; rail spike 421.59

Cognac; 27 ft NE. of center of crossing; 6 ft NW. of NW. corner of base of crossing signal; 11 ft E. of E. rail of north-bound track; in concrete post projecting 0.3 ft.; standard tablet stamped "23 RLB 1949 399" *USGS REPORT* NOT FOUND 4/17/89 399.194

Reference mark; 63 ft SW. of tablet; 41 ft SW. of center of crossing; 7 ft W. of W. rail; on NE. corner of concrete foundation of block signal P-2461; chiseled L 401.25

U.E., Cognac; 1.2 mi SE. of, along sand rd.; 131 ft NW. of intersection of private lane SE.; 40 ft W. of center of rd.; in base on E. side of 12-in. pine tree; copper nail and washer 369.17

Cognac, 2.7 mi SE. of, along sand rd.; 0.6 mi SW. of bridge over Gum Swamp Creek which is boundary between Richmond and Scotland Counties; 33 ft SE. and 24 ft SW. of crossroads; in concrete post projecting 0.3 ft.; standard tablet stamped "24 RLB 1949 351" 350.984

Reference mark; 68 ft NW. of tablet; 37 ft NW. and 19 ft SW. of crossroads; in base on NE. side of 12-in. pine tree; rail spike 349.35

U.E., Cognac, 2.7 mi SE. of, thence 0.9 mi NE. along sand rds.; 0.3 mi NE. of Richmond-Scotland County line; 19 ft SE. of center of rd.; in base on SE. side of 12-in. pine tree; rail spike 294.05

Marston, 4.0 mi SE. of, along sand rds.; 1.0 mi NE. of Richmond-Scotland County line; 54 ft S. and 43 ft E. of junction of T-rd. E.; in concrete post projecting 0.3 ft.; standard tablet stamped "25 RLB 1949 322" *USGS REPORT* NOT FOUND 4/17/89 321.915

Reference mark; 11 ft NW. of tablet; 36 ft E. of junction of T-rd.; in base on SW. side of 12-in. pine tree; rail spike 322.29

U.E., Marston, 4.0 mi SE. of, thence 0.9 mi NE. along sand rds.; 12 ft N. of center of rd.; on E. side of ridge; at sharp slope in hill to E.; in base on N. side of 12-in. pine tree; rail spike 368.91

Marston, 4.0 mi SE. of, thence 1.7 mi NE. along sand rds.; 0.3 mi NE. of main crossroads; 63 ft NE. of Y-rd. forks; 39 ft N. of center of forks of rd. E.; 30 ft E. of center of forks of rd. N.; in concrete post projecting 0.3 ft.; standard tablet stamped "26 RLB 1949 396" 395.772
*USGS REPORT MARK FOUND AS DESCRIBED.
LEANING SLIGHTLY. 4/17/89*

Book AV 82

1949

LINE 6 (Cont'd.)Feet

Reference mark; 101 ft SW. of tablet; 25 ft N. and 46 ft W. of forks of rd. N.; in base on N. side of 10-in. red oak tree; copper nail and washer 398.18

U.E., Silver Hill, 4.9 mi NW. of; 4.0 mi SE. of, thence 3.0 mi NE. from Marston; 17 ft S. and 24 ft E. of junction of fire lane E.; in base on E. side of 12-in. pine tree; rail spike 382.34

LINE 7.

R. L. Beitle, 1949; Book AV 82

"Q 52 1933" (NGS) *USGS REPORT (GDW) OLD COCA COLA BOTTLING PLANT, DESTROYED 1/23/89. PLANT TORN DOWN AFTER BEING BURNED OUT. NEW BUILDING NOW ON SITE.* 323.369

Hamlet, 0.9 mi SW. of, along State Highway 77, thence 0.7 mi SW. along macadam rd.; 31 ft S. and 21 ft W. of junction of T-rd. N.; in concrete post; standard tablet stamped "29 RLB 1949 374" 373.770

Reference mark; 245 ft NE. of tablet; 38 ft N. of center of rd.; in base on N. side of 10-in. pine tree; rail spike 373.14

U.E., Hamlet, 0.9 mi SW. of, along hwy., thence 1.6 mi SW. along macadam rd.; 108 ft NE. of intersection; 31 ft N. of center of rd. E.; on top of boundary post; chiseled U 345.67

LINE 8.

W. S. Monk, 1949; Book AV 84

Hoffman; 2.8 mi SW. of station, along U. S. Highway 1; 80 ft S. and 30 ft E. of junction of hwy. and rd. SE. to Laurel Hill; 4-in. higher than hwy.; 2 ft E. of telephone pole; in concrete post; standard tablet stamped "20 WSM 1949 440" *USGS REPORT - ROAD IMPROVEMENTS MAKE RECOVERY UNLIKELY. GDW* NOT FOUND *4/17/89* 439.982

Reference mark; 40 ft N. of tablet; on S. end of concrete headwall of culvert; chiseled square 436.52

U.E., Hoffman, 3.9 mi SW. of, along hwy.; 175 ft SE. of SE. corner of Marston Broom Works; 90 ft S. and 10 ft W. of junction of hwy. and rd. SE. to Laurel Hill; on N. corner of concrete foundation of warning signal; 2.5 ft above ground; chiseled square 429.78

Hoffman, 4.8 mi SW. of, along hwy.; 0.1 mi NW. of junction of U. S. Highway 1 and State Highway 77; 40 ft N. and 30 ft E. of junction of hwy. and rd. NW. to Ellerbe; 3 ft S. of telephone pole; in concrete post projecting 0.3 ft.; standard tablet stamped "21 WSM 1949 409" *USGS REPORT IMPROVEMENTS TO ROAD MAKE RECOVERY UNLIKELY. GDW* NOT FOUND *4/17/89* 409.225

U.E., Hoffman, 4.8 mi SW. of, along U. S. Highway 1, thence 0.9 mi W.; 70 ft N. and 30 ft W. of intersection of Ellerbe Road and N.-S. rd.; at orchard; in root on SE. side of 9-in. oak tree; copper nail and washer 444.95

U.E., Hoffman, 4.8 mi SW. of, along U. S. Highway 1, thence 1.3 mi W.; 40 ft S. and 85 ft E. of junction of Ellerbe Road and rd. N. to fish hatchery; 2 ft higher than rd.; in root on N. side of 8-in. pine tree; copper nail and washer 386.73

LINE 8 (Cont'd.)Feet

Hoffman, 4.8 mi SW. of, along U. S. Highway 1, thence 2.0 mi W.; 0.1 mi W. of residence on S. side of rd.; 30 ft N. and 75 ft W. of junction of Ellerbe Road and field rd. S.; 10 ft E. of blazed 10-in. pine tree; in concrete post projecting 0.3 ft.; standard tablet stamped

"22 WSM 1949 381" *MARK FOUND LYING ON ITS SIDE COMPLETELY OUT OF GROUND. GDW USGS DESTROYED 4/17/89* 381.051

LINE 9.

W. S. Monk, 1949; Book AV 84

Ledbetter, 0.4 mi NE. of, along dirt rd.; 0.1 mi SW. of Dawkins grocery store; 253 ft E. of E. end of steel bridge over Ledbetter Pond; 60 ft S. of center of rd.; in 6- by 6-in. concrete

post set among quartz boulders; standard tablet stamped "TT 3 HF 1949 255" *USGS REPORT MARK FOUND BROKEN OFF WITH SIGN OF CAP REMAINING IN POST. GDW USGS DESTROYED 4/17/89* 255.440

Reference mark; 260 ft W. of tablet; on NE. concrete abutment of steel girder bridge over Ledbetter Pond; chiseled square *DEST BRIDGE TORN DOWN & REPLACED 4/17/89* 238.26

U.E., Ledbetter; 260 ft N. and 40 ft E. of crossroads; near Methodist Church; in root on E. side of 12-in. pine tree; copper nail and washer 294.76

U.E., Ledbetter; 0.4 mi N. of Methodist Church; 190 ft N. and 15 ft E. of junction of Ledbetter- Ellerbe Road and rd. W.; in root on SW. side of 20-in. maple tree; copper nail and washer 309.25

LINE 10.

W. S. Monk, 1954; Book AV 390

Ledbetter, 1.4 mi NW. of Methodist Church; 69 ft S. and 37 ft E. of T-rd. E.; 48 ft E. of center of main rd.; 3 ft S. of power pole; in concrete post projecting 0.4 ft.; standard tablet stamped "TT 2 HF 1949 354" *USGS REPORT MARK LEAVING SLIGHTLY. DISTURBED 4/17/89* 354.129

Reference mark; 250 ft S. of tablet; in face on W. side of 6-in. oak tree; rail spike 344.77

U.E. Copper nail and washer (Described in line 9) 309.25

LINE 11.

W. S. Monk, 1949; Book AV 390

"29 RLB 1949 374" (Described in line 7) 373.770

10

HAMLET

N.C.-S.C.

H. L. Zohn

Book AV 1616

1971

LINE 12.

feet

H. L. Zohn, 1971; Book AV 1616

- | | | | | |
|-------------|----|------|--|----------------------------------|
| 1 | 61 | 0.00 | "W 52 1933" (NGS) | 254.356 |
| 1 | 61 | 0.45 | Gibson, 0.5 mi SW. of; on North Carolina-South Carolina State line; on property of J. C. Hunsucker; in cultivated area at S. edge of orchard; 38 ft W. of State Highway 203; at end of pavement; 22 ft from monument lettered 1905; in concrete post; NGS standard triangulation station disk stamped "GIBSON 1933" (Also described in line 3) | 249.799 |
| 1 | 62 | 0.56 | Reference mark No. 2; 36 ft SE. of center of State Highway 79; 2 ft E. of transformer pole; 1 ft SW. of 4- by 4-in. white witness post; in concrete post projecting 0.2 ft above ground; NGS standard reference mark disk stamped "GIBSON NO 2 1933-1937" | NOT FOUND <u>4/17/89</u> 251.137 |
| 1 | 63 | 0.89 | U.E., in centerline of State Highway 79 at drain crossing; copper nail and washer, painted "CL 231-2" | 231.23 |
| WL = 224 ft | | | | |
| 1 | 64 | 1.29 | U.E., in junction of State Highway 79 and County Road 28 (S.); copper nail and washer, painted "CL 240.1" | 240.08 |

NGVD 29
Elevations